

# 3

THE **adlog**<sup>TM</sup> AIRCRAFT  
MAINTENANCE  
RECORDKEEPING  
SYSTEM

**ENGINE  
MAINTENANCE  
RECORDS**

# ENGINE MAINTENANCE RECORDS

Log No. 1

Aircraft Registration No. N8757Q

Engine Manufacturer Continental

Model I0-520-F-9

Serial No. 564298

Date installed on aircraft Original 1976

Time Between Overhauls (TBO) 1700 Hours

If used on multi-engine aircraft:

- Right       Left  
 Front       Rear

TTSN = ACTT  
TSOH = ACTT - ~~5363.9~~ 3563.9  
TBO = 5363.9 - ACTT

DATE	TOTAL TIME IN SERVICE	TOTAL TIME SINCE OVERHAUL	TACH OR RECORDING METER TIME	DESCRIPTION OF WORK PERFORMED— SIGNATURE & CERTIFICATE NO. OF PERSON PERFORMING WORK
	3217.7	1347.0	3217.7	TOTALS brought forward from previous page
4/23/96	3217.7	1347.0	3217.7	<p><b>4/23/96 Tach: 3217.7</b>            CHANGE OIL, CLEAN SCREEN,            INSTALL NEW GASKET AND TORQUE            TO 500 in lbs..            INSTALL 12qts AEROSHELL 50W OIL.            CLEAN ENGINE AND FIRE WALL.            RUN ENGINE &amp; INSPECT FOR LEAKS.            LUB ALL CABLES AND LINKAGE.</p> <p><i>[Signature]</i>            APP46589372PA</p>
8/27/96	3242.2	1371.5	3242.2	<p><b>8/27/96 Tach: 3242.2</b>            CHANGE OIL, CLEAN SCREEN,            INSTALL NEW GASKET AND TORQUE            TO 500 in lbs..            INSTALL 12qts AEROSHELL 50W OIL.            CLEAN ENGINE AND FIRE WALL.            RUN ENGINE &amp; INSPECT FOR LEAKS            LUB ALL CABLES AND LINKAGE.</p> <p><i>[Signature]</i>            APP46589372PA            ANTHONY F. DAWOOD</p>
				<p>Time since last            oil change: 24.5 hrs</p>
10/1/96	3244.0	1373.3	3244.0	<p><b>10/1/96, TACH: 3244.0</b>            REMOVE INJECTOR NOZZLES, CLEAN,            INSPECT AND REPLACE.            INSTALL 12 NEW CHAMPION RHB-32E            SPARK PLUGS AND GASKETS.            COMPRESSION TEST RESULTS:            CYL #1=76, 2=78, 3=78, 4=78,            CYL #5=76, 6=78.            REPAIR RIGHT SIDE ENGINE BAFFLE            BY RE-ENFORCING W/SHEET ALUMINUM.</p>
<b>1996 ANNUAL INSPECTION</b>				
	26.3	26.3	26.3	SUB-TOTALS this page
	3244.0	1373.3	3244.0	TOTALS—Carry forward to next page

DATE	TOTAL TIME IN SERVICE	TOTAL TIME SINCE OVERHAUL	TACH OR RECORDING METER TIME	DESCRIPTION OF WORK PERFORMED— SIGNATURE & CERTIFICATE NO. OF PERSON PERFORMING WORK
	3244.0	1373.3	3244.0	TOTALS brought forward from previous page
10/1/96	3244.0		3244.0	<p>REPLACE ALT AIR SOURCE MECHANISM ON INDUCTION AIR BOX WITH, PART #S: 1250311-1 SHAFT, 125070-5 SPRING HOLDER, 0850500-30 CONTROL ARM, UPPER AND LOWER BEARINGS AND SPRING, AND PN 1250306-6 ALT AIR DOOR ASSY. CLEAN AND SEAL AIR BOX AND INSTALL NEW GASKET #653742. INSTALL NEW THROTTLE ACTUATED AUX FUEL PUMP MICRO-AWITCH ASSY. PN 1250706-5.</p> <p>REPLACE CHAFFED VACUM DELIVERY HOSE ON VACUM PUMP TO VACUM REGULATOR. REPLACE CHAFFED SCAT HOSE OVER FUEL LINE TO FUEL PUMP. REMOVE FUEL PUMP SCREED, CLEAN &amp; INSTALL WITH NEW GASKET AND SAFETY WIRE. REMOVE FUEL STRAINER BOWL &amp; SCREEN. CLEAN, INSPECT AND INSTALL WITH NEW O'RING AND SAFETY WIRE. REMOVE RIGHT SIDE EXHAUST HEADER DUE TO SMALL CRACK. SEND HEADER, MUFFLER, AND TAILPIPE TO PMA FAB. FOR INSPECTION AND REPAIRS. PMA PATCHED CRACK IN HEADER AND <del>INS</del>REPLACED DEFUSSER IN MUFFLER. RE-INSTALL R/HEADER, MUFFLER AND TAILPIPE. INSPECT LEFT MUFFLER DEFUSSER AND HEADER. ALL AD'S C/W THRU FEDERAL BI-WEEKLY #96-12-22. REPLACE VACUM REGULATOR SPONGE FILTER, PN: B3-5-1. REPLACE BRACKET AIR FILTER ELEMENT PN: BA-2205L. INSPECT ALT BELT.</p> <p>THIS ENGINE IASP I.A.W AN ANNUAL AND IS APPROVED FOR RETURN TO SERVICE</p> <p><i>[Signature]</i> AP46589572IA ANTHONY R. DAVIS</p>
<b>1996 ANNUAL INSPECTION CONTINUED.</b>				

Ø	Ø	Ø
3244.0	1373.3	3244.0

SUB-TOTALS this page  
TOTALS—Carry forward to next page



DATE	TOTAL TIME IN SERVICE	TOTAL TIME SINCE OVERHAUL	TACH OR RECORDING METER TIME	DESCRIPTION OF WORK PERFORMED— SIGNATURE & CERTIFICATE NO. OF PERSON PERFORMING WORK
	3277.4	1406.7	3277.4	TOTALS brought forward from previous page
11/11/96	3277.4	1406.7	3277.4	<p>Tach: 3277.4 Hobbs: 185.4 11/11/96                      Replace all baffle seals w/red sil seal material                      Install new front crankshaft seal.                      Remove prop assy, remove old seal, clean all surfaces, ply-bond new seal edge, and install new seal. Re-install prop assy.                      Change Oil, run engine and exercise prop and check for leaks. All tests OK, RTS.</p> <p>Time Since Last Oil Change: 11.6 hrs</p> <p> A&amp;P465893721A                      Technician Cert #</p>
9/8/97	3291.6	1420.9	3291.6	<p><u>9/8/97 N8757Q Engine Repairs</u></p> <p>#1 Cylinder showing signs of barrel separation.                      #3 Cylinder has stuck exhaust valve and broken inner valve spring.                      Ship both cylinder assys to CEU. #1 Cylinder exchanged for another IRAN cylinder.                      #3 Cylinder left for IRAN overhaul.                      CEU work order #29165-4873 See invoice and green tags in Log files. Install both cylinders, replace right mag gasket, time mags, replace rocker axles, and manifold overflow tube. Run up, flight test, inspect for leaks. All checks OK, RTS.</p> <p>                      Tony D'Aiuto A&amp;P465893721A</p> <p>Time Since Last Oil Change: 14.2 hrs</p> <p>Change Oil &amp; clean Oil Screen                      install 12QTS Arcoshell 100 50W oil</p>
	14.2	14.2	14.2	SUB-TOTALS this page
	3291.6	1420.9	3291.6	TOTALS—Carry forward to next page

DATE	TOTAL TIME IN SERVICE	TOTAL TIME SINCE OVERHAUL	TACH OR RECORDING METER TIME
	3291.6	1420.9	3291.6
12/2/97	3312.8	1442.1	3312.8

DESCRIPTION OF WORK PERFORMED—  
SIGNATURE & CERTIFICATE NO. OF PERSON PERFORMING WORK

TOTALS brought forward from previous page.

**1997 ANNUAL INSPECTION**

Inspect induction airbox assy, scat hoses, fuel lines, cables, wiring, vac lines, wash down engine, clean fuel pump screen. Clean/inspect fuel strainer bowl/screen, and injector nozzles. Install 12 new Champ RHB32E Spark Plugs and gaskets. Replace vacume regulator sponge filter, PN B3-5-1. Replace Bracket Airfilter element PN BA-2205L. Inspect alternator belt. Install 12 quarts Aeroshell 50w oil. Inst new oil screen w/Teledyne Q9T 116-07. Run up engine inspect for leaks. Lub all cables and linkage. Do Comp. Test. Results: #1-76, #2-78, #3-78, #4-78, #5-78, #6-77.

All AD's c/w thru Fed Bi-Wk 97-1-13  
This engine Inspected IAW an Annual Inspection and is approved for return to service.

  
Tony D'Aidfo A&P46589372IA

Time Since Last oil change: 21.2 hrs

**OIL CHANGE**

Time Since Last oil change: 12.4 hrs.

4/17/98	3325.2	1454.5	3325.2
---------	--------	--------	--------

4/17/98  
Tach: 3325.2  
Hobbs: 238.4

Drain Oil, and install 12 Qts. AeroShell 100 50w oil.

Clean & Lub front strut and nose wheel steering mech.

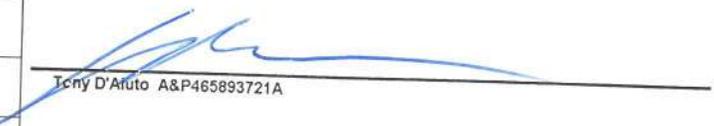
 A&P46589372IA

33.6	33.6	33.6
3325.2	1454.5	3325.2

SUB-TOTALS this page

TOTALS—Carry forward to next page



DATE	TOTAL TIME IN SERVICE	TOTAL TIME SINCE OVERHAUL	TACH OR RECORDING METER TIME	DESCRIPTION OF WORK PERFORMED— SIGNATURE & CERTIFICATE NO. OF PERSON PERFORMING WORK
	3339.0	1468.3	3339.0	TOTALS brought forward from previous page
5/20/98	3353.5	1482.8	3353.5	<p>OIL CHANGE:                      Drain oil and install 12qts. Aeroshell 100 / 50w oil</p> <p>Found small amt of oil leaking from valve cover on #6 cylinder. Remove valve cover, clean surfaces and install new gasket. Tighten all vave covers.</p> <p>Replace worn rubber grommets on engine heat shields for spark plug wire protection.</p> <p>Repair broken ground lead on right magneto.                      Replace broken bolt in left side exhaust slip joint.                      Repair broken tailpipe hanger on left side, and replace mounting bolts. Repair oil cooler top baffle bracket.</p> <p>Time Since Last Oil Change 14.5 hrs.</p> <p>                      Tony D'Aluto A&amp;P465893721A</p>
6/10/98	3373.0	1502.3	3373.0	<p>OIL CHANGE:                      Drain oil and install 12qts. Aeroshell 100 / 50w oil</p> <p>Remove Oil Screen, clean screen, replace felt washer and gasket.</p> <p>Remove fuel screen from bottom of servo, clean screen and install new gasket.</p> <p>                      Tony D'Aluto A&amp;P465893721A</p> <p>Time Since Last oil change: 19.5 hrs.</p>
	34	34	34	
	3373.0	1502.3	3373.0	SUB-TOTALS this page
	3373.0	1502.3	3373.0	TOTALS—Carry forward to next page

DATE	TOTAL TIME IN SERVICE	TOTAL TIME SINCE OVERHAUL	TACH OR RECORDING METER TIME	DESCRIPTION OF WORK PERFORMED— SIGNATURE & CERTIFICATE NO. OF PERSON PERFORMING WORK
	3373.0	1502.3	3373.0	TOTALS brought forward from previous page
7/29/58	3386.3	1515.6	3386.3	<p><b>OIL CHANGE:</b>                      Drain oil and install 12qts. Aeroshell 100 / 50w oil</p> <p>Did not remove or service oil screen at this time.</p> <p><i>John Marshall</i>                      _____                      John Marshall Pilot Cert. # 14321962</p> <p>Time since last oil change: 13.3 hrs</p>
8/12/58	3407.0	1536.3	3407.0	<p><b>OIL CHANGE:</b>                      Drain oil and install 12qts. Aeroshell 100 / 50w oil</p> <p>Remove Oil Screen, clean screen, replace felt washer and gasket.</p> <p>Install Oil Screen Assy and torque to specs.</p> <p><i>John Marshall</i>                      _____                      John Marshall Pilot Cert. # 14321962</p> <p>Time since last oil change: 20.7 hrs</p>
	34	34	34	SUB-TOTALS this page
	3407.0	1536.3	3407.0	TOTALS—Carry forward to next page

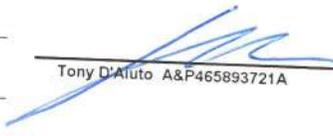
DATE	TOTAL TIME IN SERVICE	TOTAL TIME SINCE OVERHAUL	TACH OR RECORDING METER TIME	DESCRIPTION OF WORK PERFORMED— SIGNATURE & CERTIFICATE NO. OF PERSON PERFORMING WORK
------	-----------------------	---------------------------	------------------------------	---

	3407.0	1536.3	3407.0
--	--------	--------	--------

TOTALS brought forward from previous page

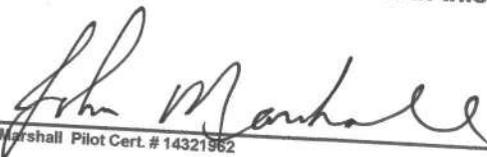
9/3/98	3411.5	1540.8	3411.5
--------	--------	--------	--------

9-3-98  
TACH  
REPLACED STARTER WITH OVERHAUL, ALSO REPLACED LH MOUNT FOR EXHAUST TAILPIPE WITH NEW. SERVICED A/C BATTERY. RUN ENGINE OPS CHK. OK.

  
Tony D'Aluto A&P465893721A

9/27/98	3439.3	1568.6	3439.3
---------	--------	--------	--------

OIL CHANGE:  
Drain oil and install 12qts. Aeroshell 100 / 50w oil  
Did not remove or service oil screen at this time.

  
John Marshall Pilot Cert. # 14321962

Time since last oil change: 32.3 hrs

32.3	32.3	32.3
3439.3	1568.6	3439.3

SUB-TOTALS this page

TOTALS—Carry forward to next page

DATE	TOTAL TIME IN SERVICE	TOTAL TIME SINCE OVERHAUL	TACH OR RECORDING METER TIME	DESCRIPTION OF WORK PERFORMED— SIGNATURE & CERTIFICATE NO. OF PERSON PERFORMING WORK
	3439.3	1568.6	3439.3	TOTALS brought forward from previous page
10/16/98	3457.5	1586.8	3457.5	<p><b>OIL CHANGE:</b>                      Drain oil and install 12qts. Aeroshell 100 / 50w oil</p> <p>Remove Oil Screen, clean screen, replace felt washer and gasket.</p> <p>Install Oil Screen Assy and torque to specs.</p> <p><i>John Marshall</i>                      _____                      John Marshall Pilot Cert. # 14321962</p> <p>Time since last oil change:                      18.2 hrs</p>
12/6/98	3473.8	1603.1	3473.8	<p>Remove all fuel injector nozzles, clean, inspect and re-install. Repalce all spark plugs with new champion RHB32E plugs. Differential compression test all cylinders using 80 psi reference pressure.</p> <p>Results by cylinder #:                      1 - 79 / 2 - 80 / 3 - 78 / 4 - 80 / 5 - 80 / 6 - 68</p> <p>Work performed in accordance with Cessna 206 basic service manual D2007-13</p> <p>Ops check OK. Completed and returned to service 12/6/98.</p> <p><i>Tony D'Aiuto</i>                      _____                      Tony D'Aiuto A&amp;P465893721A</p>
1/2/99	3479.2	1608.5	3479.2	<p>Perform annual inspection in accordance with Cessna 206 Stationair basic service manual D2007-13 and FAR Part 43, Appendix D.</p> <p>All AD's complied with thru biweekly AD 98-25-10</p> <p>Pressure wash engine, firewall, engine compartment and cowling. Runup check for oil and exhaust leaks.</p> <p>Ops check OK. Completed and returned to service 1/2/99.</p> <p><i>Tony D'Aiuto</i>                      _____                      Tony D'Aiuto A&amp;P465893721A</p>
	39.9	39.9	39.9	SUB-TOTALS this page
	3479.2	1608.5	3479.2	TOTALS—Carry forward to next page







1. UNITED STATES		2. <b>FAA FORM 8130-3</b> AIRWORTHINESS APPROVAL TAG U.S. Department of Transportation Federal Aviation Administration				3. System Tracking Ref. No. <b>026</b>	
4. Organization Tropic Airpower, Inc. Lantana, Florida www.tropicairpower.com					5. Work Order, Contract, or Invoice Number <b>426</b>		
6. Item	7. Description	8. Part Number	9. Eligibility *	10. Quantity	11. Serial/Batch Number	12. Status/Work	
1	Powerplant IO520F TRV CONTINENTAL		BY INSTALL	1	564298	MOH	
13. Remarks <b>-ENGINE MAJOR OVERHAULED-</b>							
Limited life parts must be accompanied by maintenance history including total time/total cycles/time since new.							
14. New <input type="checkbox"/> Newly Overhauled <input checked="" type="checkbox"/> Certifies that the new or newly overhauled part(s) identified above, except as otherwise specified in block 13 was (were) manufactured in accordance with FAA approved design data and airworthiness. NOTE: In case of parts to be exported, the special requirements of the importing country have been met.				15. Return to Service in Accordance with FAR 43.9 Certifies that the work specified in block 13 (or attached) above was carried out in accordance with FAA airworthiness regulations and in respect to the work performed the part(s) is (are) approved for return to service.			
16. Signature <i>Mark Young</i>		16. FAA Authorization No.		20. Signature <i>Mark Young</i>		21. Certificate Number: T7KRJ87Y	
17. Name (Typed or Printed) MARK YOUNG		18. Date 3/13/2000		22. Name (Typed or Printed)		23. Date	

Page No.

PERFORMED—  
PERSON PERFORMING WORK

564298 after  
w engine mount  
overhauled prop  
engine.  
ice manual.  
eward.  
Hose, Ft Laud, FL  
see documents  
part #s & details.

John F. Marshall  
AP14321962

3-20-00 3563.9 - 0 - 3563.9

I certify that this Engine has been inspected in accordance with an annual inspection, 14 CFR, Part 43, and found to be in an airworthy condition. All AD notes have been complied with thru bi-weekly 2000-04, and a record of compliance placed in the aircraft records. This Engine has Zero time Since major overhaul. TBO = 1700 hrs.

Anthony D'Aiuto  
A&P 46589372 IA

- 0 - - 0 - - 0 -  
3563.9 - 0 - 3563.9

SUB-TOTALS this page

TOTALS—Carry forward to next page

It is important to understand that the existence of this Document alone does not automatically constitute authority to install the part/component/assembly. Where the user/installer work in accordance with the national regulations of an Airworthiness Authority different than the Airworthiness Authority of the country specified in block 1 it is essential that the user/installer ensures that his/her Airworthiness Authority accepts parts/components assemblies from the Airworthiness Authority of the country specified in block 1 it is essential

User/Installer Responsibilities

DATE	TIME IN SERVICE	TIME SINCE OVERHAUL	RECORDING METER TIME	DESCRIPTION OF WORK PERFORMED— SIGNATURE & CERTIFICATE NO. OF PERSON PERFORMING WORK
	3563.9	-0-	3563.9	TOTALS brought forward from previous page
3-17-00	3563.9	-0-	3563.9	Install IO-520-F Continental Engine, SN 564298 after major overhaul. Install 4 new Engine shock mounts, new engine mount hardware, and torque to specs. Mount overhauled prop governor and overhauled alternator to engine. Install iaw Cessna U206 approved service manual. Install all new engine hoses firewall foreward. Hoses manufactured by Teleflex Aero Hose, Ft Laud, FL Nine hoses maufactured and replaced, see documents in engine overhaul folder of this log for part #s & details.   John F. Marshall AP14321962
3-20-00	3563.9	-0-	3563.9	I certify that this Engine has been inspected in accordance with an annual inspection, 14 CFR, Part 43, and found to be in an airworthy condition. All AD notes have been complied with thru bi-weekly 2000-04, and a record of compliance placed in the aircraft records. This Engine has Zero time Since major overhaul. TBO = 1700 hrs.           Anthony D'Aiuto A&P 46589372 IA
	-0-	-0-	-0-	SUB-TOTALS this page
	3563.9	-0-	3563.9	TOTALS—Carry forward to next page

DATE

NO. 15

DATE	TOTAL TIME IN SERVICE	TOTAL TIME SINCE OVERHAUL	TACH OR RECORDING METER TIME
	3563.9	-0-	3563.9
3-30-00	3569.0	5.1	3569.0
7-4-00	3587.9	24.0	3587.9
7-18-00	3595.9	32.0	3595.9
7-22-00	3595.9	32.0	3595.9
	32.0		
	3595	32.0	32.0
	3595.9	32.0	3595.9

DESCRIPTION OF WORK PERFORMED—  
SIGNATURE & CERTIFICATE NO. OF PERSON PERFORMING WORK

TOTALS brought forward from previous page

Remove oil filter, cut and inspect.  
Install new Champ 108 oil filter.  
Inspect engine area for leaks, chaffing, etc.

*John F. Marshall*  
John F. Marshall

**OIL CHANGE:** Time since last oil change: 24.0

Drain oil and install 12 qts. Aeroshell Multi-Wt.

Install new Champ CH 48109 Oil Filter.  
Safety wire and torque to mfr's specs.

Cut used oil filter open and inspect.

Take oil sample to send in for analysis.

Wash engine and engine compartment, run engine and inspect for leaks.

*John F. Marshall*  
AP14321962 John F. Marshall

7-18-00 Remove starter adapter and send out to Tropical Airpower for warranty repairs.

7-22-00 Install overhauled starter adapter.  
Yellow Tag and repair paperwork attached.

*John Marshall*  
John Marshall  
AP14321962

SUB-TOTALS this page

TOTALS—Carry forward to next page





DESCRIPTION OF WORK PERFORMED—  
SIGNATURE & CERTIFICATE NO. OF PERSON PERFORMING WORK

DATE	TOTAL TIME IN SERVICE	TOTAL TIME SINCE OVERHAUL	TACH OR RECORDING METER TIME	
	3656.5	92.6	3656.5	TOTALS brought forward from previous page
3-24-02	3673.0	109.1	3673.0	Change oil & Filter. Install 12 qts Aeroshell Plus 100/50W and CH48109 oil Filter. Lub engine Prop Control cables & linkage. CK and LEAK check OK. 25.2 Hours since last oil change. Next Due @ 3698 Hrs. John Marshall AP14321
5-18-02	3696.4		3696.4	Change oil & Filter Install 12 qts Aeroshell plus 100/50W and change CH48109 oil Filter. 23 hours since John Marshall AP14321
8-17-02	3698.8		3698.8	Install overhauled vacuum pump PN 212CW SN 101052 Ops OK OK John Marshall AP14321
10-13-02	3716.9		3716.9	change oil and Filter. Install 12 qts Aeroshell 100/50W oil and CH48109 Filter. LEAK check and Ops OK. 20.5 HRS since last oil change. John Marshall AP14321

60.4	60.4	
3716.9	153.0	3716.9

SUB-TOTALS this page  
TOTALS—Carry forward to next page



DATE	TOTAL TIME IN SERVICE	TOTAL TIME SINCE OVERHAUL	TACH OR RECORDING METER TIME	DESCRIPTION OF WORK PERFORMED— SIGNATURE & CERTIFICATE NO. OF PERSON PERFORMING WORK
	3754.5	190.6	3746.5	TOTALS brought forward from previous page
2/1/04	3754.5	190.6	3754.5	Change oil & Filter. Install CH48109 oil Filter and 12 QTS Avoshell 100 oil. Leak check, Run-up & ops check OK John Marshall AP14321962
2/1/04	3754.5	190.6	3754.5	C/W AD # 2004-08-10 ECZ cylinders AD. This AD is found to be N/A by not installed. The ECZ cylinders installed in this AC do not fall in scope John Marshall AP14321962IA
2/15/05	3768.6			

I certify this engine has been inspected in an annual inspection and has been found to be in airworthy condition and approved for RTS this date.  
 Installed 12 quarts Aeroshell 100 oil and CH48109 filter.  
 Leak check and ops check OK.  
 All AD's cw thru bi-weekly 2005-3.  
 Continental Model: IO520-F9 SN: 564298  
 Last overhauled on 3/13/00 by Tropic Airpower Inc, in Lantana, FL under WO # 426  
 END

*John Marshall*  
 John Marshall AP14321962IA

SUB-TOTALS this page

TOTALS—Carry forward to next page

DATE	TOTAL TIME IN SERVICE	TOTAL TIME SINCE OVERHAUL	TACH OR RECORDING METER TIME	DESCRIPTION OF WORK PERFORMED— SIGNATURE & CERTIFICATE NO. OF PERSON PERFORMING WORK
<b>TOTALS</b> brought forward from previous page				
2/18/06	3769.5			<p>I certify this engine has been inspected iaw an annual inspection and found to be in airworthy condition and Approved for RTS this date. Run-up year OK &amp; ops OK OK All AD's C/W thru biweekly 2006-3 and Compliance sheet placed in permanent record John Marshall AP14321962 IA</p>
2/12/07	3770.5			<p>I certify this engine has been inspected iaw an annual inspection and found to be in airworthy condition, and Approved for RTS this date. Ops OK &amp; Lease OK, OK. All AD's C/W thru 2007-3 biweekly. John Marshall AP 14321962 IA</p>
<b>SUB-TOTALS</b> this page				
<b>TOTALS</b> —Carry forward to next page				

NOTE: In case of an accident, the operator shall be held responsible for the damage caused to the aircraft.  
 17. NAME (TYPE OR PRINTED)  
 18. DATE  
 22. NAME (TYPE OR PRINTED)  
 23. DATE  
 15. SIGNATURE  
 16. DATE  
 19. NAME (TYPE OR PRINTED)  
 20. DATE  
 21. NAME (TYPE OR PRINTED)  
 24. DATE

3-1-

DATE	TOTAL TIME IN SERVICE	TOTAL TIME SINCE OVERHAUL	TACH OR RECORDING METER TIME	DESCRIPTION OF WORK PERFORMED— SIGNATURE & CERTIFICATE NO. OF PERSON PERFORMING WORK
2/30/08	3771.9			<p>TOTALS brought forward from previous page</p> <p>A/C REG # <u>N8757Q</u> DATE <u>2/30/08</u>            TOTAL A/C TIME <u>3771.5</u> HRS. TACH TIME <u>3771.5</u></p> <p>I CERTIFY THAT THIS A/C HAS BEEN INSPECTED IN ACCORDANCE WITH AN (CIRCLE ONE) ANNUAL 100 HR INSPECTION AS PER _____ AND WAS DETERMINED TO BE IN AN AIRWORTHY CONDITION. <u>Annual</u>  <u>14 CFR PART 43</u></p> <p><u>John Marshall</u> <u>AP014321962 IA</u>            SIGNATURE CERTIFICATE NO./TYPE</p>
3/1/09	3772.5			
4/1/10	3773.0	209.1 <del>3773.0</del>		<p>I certify this engine has been inspected iaw an annual inspection and has been found to be in airworthy condition and approved for RTS this date.            Installed 12 quarts Aeroshell 100 oil and CH48109 filter. Leak check and ops check OK.            All AD's cw.            Continental Model: IO520-F9 SN: 564298            Last overhauled on 3/13/00 by Tropic Airpower Inc, in Lantana, FL under WO # 426            END  <u>John Marshall</u>            John Marshall AP14321962IA</p>
				<p>I certify this engine has been inspected iaw an annual inspection and has been found to be in airworthy condition and approved for RTS this date.            Installed 12 quarts Aeroshell 100 oil and CH48109 filter. Leak check and ops check OK. Clean all fuel injector nozzles iaw cessna svc manual. Install all new spark plugs Champ RHB32E            Right Bank: cylinder 1-76/80, 3-76/80, 5-78/80            Left Bank: cylinder 2-78/80, 4-76/80, 6-78/80 All AD's cw.            Continental Model: IO520-F9 SN: 564298            Last overhauled on 3/13/00 by Tropic Airpower Inc, in Lantana, FL under WO # 426 SMOH 209.1            END  <u>John Marshall</u>            John Marshall AP14321962IA</p>

DATE	TOTAL TIME IN SERVICE	TOTAL TIME SINCE OVERHAUL	TACH OR RECORDING METER TIME	DESCRIPTION OF WORK PERFORMED— SIGNATURE & CERTIFICATE NO. OF PERSON PERFORMING WORK
				<b>TOTALS</b> brought forward from previous page

Oxford Flight Training, LLC  
 288 Christian Street  
 Waterbury-Oxford Airport  
 Oxford, CT 06478

September 23, 2010  
 Aircraft TT: 3794  
 SMOH: 230.1

Drained oil and serviced with 12 quarts Phillips 100AW. Replaced oil filter with CH48109. Performed compression check: #1)77/80 #2)76/80 #3)76/80 #4)75/80 #5)75/80 #6)75/80. Replaced engine fuel pump p/n 638154-1, s/n 3520RA. Replaced Fuel manifold with overhauled p/n 631351-17A3, s/n 1029705CR. Replaced alternator with overhauled p/n DOFF10300J, s/n 45119. Replaced alternator belt with new p/n 539547-30.00. Replaced vacuum pump with new p/n 216CW, s/n 67665. Checked Magneto to engine timing I.A.W MSB94-8C. AD 2010-11-04 not applicable by engine rebuild date. Run up and leak check ok. Inspected engine I.A.W FAR 43 Appendix D. I certify that this engine has been inspected in accordance with an annual inspection and has been determined to be in airworthy condition.

*Munidat Persaud*

Munidat Persaud A&P/IA 2643691

**SUB-TOTALS** this page

**TOTALS**—Carry forward to next page

15. SIGNATURE (WHEN OR PRINTED)  
 18. DATE  
 27. CHECK ELIGIBILITY WITH APPLICABLE TECHNICAL SPECIFICATIONS

3