

Date	N166B Maintenance Event	Logbook #	337 Approval Date
06/22/72	Airworthiness Certificate	Aircraft Log 1	
04/12/73	Bought by Beech Flying Club, Tach/TT: 472	Aircraft Log 1	
10/03/74	Removed Damaged RH Elevator, replaced with new Tach/TT: 1213.26	Aircraft Log 1	
05/14/75	Engine, Prop, and Prop Governor O/H'd, New Starter & Alternator Tach/TT: 1416,	Aircraft Log 1	
04/01/77	Repaired Rt Wing, Replaced Left Aileron, Teplaced R & L Keel Assy and skinning forward of firewall. Tach/TT: 1877.4	Aircraft Log 1	04/01/77
09/20/77	First Sstrip & Paint	Aircraft Log 1	
12/08/79	Installed O/H'd Prop, BHC-L2YF-1BF Tach/TT: 2663	Aircraft Log 1	
09/27/81	Installed new Tach:. Tach/TT: 2892.8	Aircraft Log 1	
12/13/84	5 yr Prop O/H'd pr AD 77-17-06 Tach/TT: 3192	Aircraft Log 1	
07/15/86	STC SE8879SW to use Phillip[s X/C Oil		07/15/86
03/28/88	Installed new brake lines. Tach/TT: 3326	Aircraft Log 1	
05/03/89	R/H Elevator reskinned & reinstalled Tach/TT: 3341	Aircraft Log 1	05/01/89
12/14/89	Right and Left Wing Repairs	Aircraft Log 1	12/14/89
12/15/89	5 yr Prop O/H'd pr AD 77-17-06 Tach/TT: 3389	Aircraft Log 1	
10/08/90	Switched Altimeters	Aircraft Log 1	10/08/90
01/10/91	Avionics Upgrades	Aircraft Log 1	01/10/91
04/01/91	Last entry in this logbook Tach/TT: 3510.25	Aircraft Log 1	
08/11/91	Initial log entry this logbook. Tach/TT: 3528	Aircraft Log 2A	
09/30/91	Tach Replaced at TT: 3538.8 around this date, New Tach: 0.0	Aircraft Log 2A	
01/31/92	Annual, ACF-50 treatment. Tach 82.0, TT: 3620.8	Aircraft Log 2A	
09/30/97	Removed IO-470-N and installed IO-520-BA, Field Approval	Aircraft Log 2A	10/27/97
11/01/97	Repairs made after gear-up landing. Installed McCauley prop 2A36C23-P-E-G that was removed from V35B, s/n D-9483, Prop O/H performed 8/8/94, SPOH: 200 hrs, Tach: 599.0, TT: 4137.8	Aircraft Log 2A Prop Log	09/30/97
05/05/98	Installed Beryl D'Shannon Tip Tanks per STC 808SO.	Aircraft Log 2A	05/05/98
07/01/98	Installed JPI temperature Monitoring System per STC SA2586NM	Aircraft Log 2A	07/01/98
07/01/98	Installed Fuel Flow Transducer per STC SA00432SE	Aircraft Log 2A	07/01/98
07/01/98	Installed P-1000 Digital Tachometer per STC SA5491NM, Old Tach: 616.7, New Tach: 0.0, TT: 4155.5 SPOH: 217.7, SMOH: 0.0	Aircraft Log 2A	07/01/98
07/13/98	Installed Continental IO-520BB, s/n 809612R. Installed Turbonormalizing STC SE5222NM installed Tach 0.0, TT: 4155.5	Aircraft Log 2A	07/13/98
12/20/98	Avionics Upgrade, Install Garmin GNC 300 XL	Aircraft Log 2A	02/23/99
03/10/99	Installed GAMI Fuel Injectors per STC SE09289SC	Aircraft Log 2A	03/10/99
06/14/99	Replaced windshield Great Lakes Aero .375" Windsahield	Aircraft Log 2A	06/14/99
11/07/99	Authorized Garmin GNC 300XL for IFR	Aircraft Log 2A	01/06/00
11/07/99	Installed Sandel HSI	Aircraft Log 2A	01/21/00
02/23/01	Aircraft Repainted	Aircraft Log 2A	
03/08/01	Installed STEC System 20/30 2 axis AutoPilot	Aircraft Log 2A	03/08/01
08/18/02	Interior Refurbishment: Seats, Headliner, Carpet, Sidepanels	Aircraft Log 2A	
08/19/02	Beegles Hail Repair Work Order: Fuselage, Windows, R/H & L/H Wing, R/H & L/H Stabilizer, R/H & L/H Elebator, Vertical Stabilizer & Rudder, R/H & L/H Flas, R/H & L/H Ailerons. Repainted Exterior. Tach: 455.0, TT: 4610.5	Aircraft Log 2A	
08/19/02	Prop O'H'd Tach 455, SPOH: 0.0	Prop Log	
04/20/06	Replaced windshield Great Lakes Aero .375" Windsahield (Green tint)	Aircraft Log 2A	

