		is
YEAR:	BECORDING TORANGE TORANGE	f Technician or Repair
I FMI	\Ti	
	TI	
DATE	WINGS) 22025	
DATE	T OFHOPE/ NOODE Tach 93.1 TT 1576.1 Date 5-2-2023	
	No defects found, next due 25 hrs.	
	C/W AD 55-22-02 Per AD instructions & SB-10. Fuel tanks inspection. No defects found, next due 25 hrs.	
	and the reinforcement inspection. No defects found, next due	
	118.1 Tach C/W AD 59-25-05 Per. AD instructions. Rudder reinforcement inspection. No defects found, next due	
	100nrs, 193.1 facti	
	100hrs. 193.1 fach C/W AD 03-21-01 Per. AD instructions. Wing outer panel structure inspection. No defects found, next due	
	C/W AD 03-21-01 Per. AD 1134 44-4-	
	12 month 3-2-2026	
	C/W AD 12-08-06 Per. AD & SB#35 instructions. Alleron & Balance Assy. No defects found, next due	
	C/W AD 12-08-06 Per. AD & SB#35 instructions. All Colors	
	100hrs. or 12 months. 193.1 Tach or 3-2-2026	
	100ms, of 22 men and instructions	
	AD 47-20-09 Voltage regulator check. Requires ops check Per. AD instructions	
	Inspected muffler assy, and found muffler assy, moved requiring adjustment. Replaced clamping	
	offer acry and found muffler assy, moved requiring adjustment, Replaced Services	- 1.5 (1.5) - 1.5 (1.5)
	Inspected multier assy, and defect found.	
	hardware as required. No defect found.	
	con7	
	Con Anna de la Constantina della Constantina del	
	Next PIER	
	V V	

YEAR:	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)		
	<u></u>		V	CONT From PREV PACK V		
		installed -12	Adel clamp an	d related hardware at fuel strainer support bracket.		
		Adjusted carburetor heat control cable as required. No defects found.				
		Serviced nos	e gear strut as	required. No excessive leaks found.		
		Adjusted nose gear bottom torque link as required for clearance.				
		Lubricated trim cable as required. Ops check good.				
		Lubricated and inspected nose wheel bearings and felts. Found to be in serviceable condition.				
		Performed v	isual inspection	n of Left rudder spar at center attach point and found no defects.		
		Reconnected carburetor mixture control cable and adjust as required.				
	Replaced ELT batteries, inspected FLT Operation I/A/W 91.207 Battery next due 3-2030.					
		Steve Johns	n Set	A&P3477657IA		
		'				